SPECTRO3-Scope: Changes due to software update from SPECTRO3-Scope V4.2 to 4.3

This manual summarises the changes that were made with the software update from **SPECTRO3 V4.2** to **V4.3**.

It is possible to update the software from V3.3 to V4.3. In this case, however, an intermediate step is required to save the data.

The respective procedure is exactly described in the "Firmware update SPECTRO3 V3.x to SPECTRO3 V4.x" file.

A software update from V4.x to V4.3 can be performed quite easily.

All you need is the FirmwareLoader V1.1 and the firmware files for version 4.3.

The FirmwareLoader V1.1 can be found on the CD that is provided with the sensor or can be downloaded from our homepage.

The firmware files are available from your sensor supplier.

The respective procedure is exactly described in the "Manual FirmwareLoader V1_1" file (see software CD/DVD: Folder Support Software \rightarrow Version Update \rightarrow FirmwareLoader V1.1).

Change 1:

ATTENTION!				
Could not establish connection! Close window or work in offline mode!				
CLOSE OFFLINE				
COMMUNICATION PROTOCOL RS232				
SELECT COM PORT [1256]				
SELECT BAUDRATE 115200 -				
TRY TO CONNECT DISCONNECT				
COMMUNICATION ERROR!				
NO SENSOR CONNECTED!				
ACCEPT CHANGE GEN. HW SETTINGS BAUDRATE INFO FILE				
INSERT A PANEL ID				
RAM SET SEND GO EE 0 GET STOP				

If a connection is not established automatically, e.g. if no sensor is connected, the software can be run in OFFLINE mode. In offline mode it only is possible to exchange parameters with a file on a storage medium, which often is helpful for the purpose of analysing parameter files.

If a sensor is connected and a connection still cannot be established, either the SCOPE version (program on the PC) and the firmware version (program in the sensor) do not match, or the interface to the sensor must be correctly configured.

If different Scope and firmware versions should be the problem, please get the Scope version that matches the firmware from your supplier.

Change 2:

CONNECT	
COMMUNICATION PROTOCOL	RS232 -
SELECT COM PORT [1256]	3
SELECT BAUDRATE	115200 🔽
TRY TO CONNECT DIS TRY TO CONNECT! Firmware version Serial number of sensor	
ACCEPT CHANGE SETTINGS BAUDRATE	T GEN. HW INFO FILE

When a connection is established the serial number of the contacted sensor is transferred in addition to the firmware version.

The baudrates have been extended with 230400 and 460800.

DISCONNECT disconnects the connection between sensor and PC. The software then switches to OFFLINE mode, where it is only possible to exchange parameters with a file on a storage medium.

The interface is then free for other programs (e.g. FirmwareLoader).

Change 3:

The format for the firmware and for the Scope version number has been changed.

The full version number now is a 3-character combination (a.b.c). Firmware and software can be run in combination if the first two characters (a.b) match. The third character c has been introduced to identify the remedying of possible software bugs.

1

3.

It is thus easy for the user to make sure he always uses the most recent version.


The full Scope version number is displayed after approx. 2 seconds when you move the mouse pointer on the Scope version.

SPECTRO3 Scope V4.3		
- <u>5</u> -1	SPECTRO3 Scope V4.3.0	

The full firmware version number is displayed after approx. 2 seconds when you move the mouse pointer on the status line.

COMMUNICATION PORT	3	SPECTRO3 V4.3 18/Mar/2014	
		SPECTRO3 V4.3.0	18/Mar/2014

Change 4:

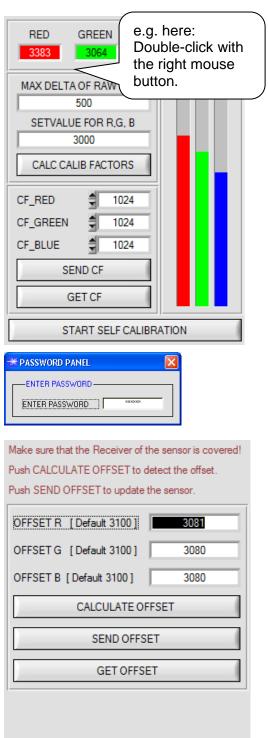

CLOSE

Accessing offset calibration now requires a double-click with the right mouse button exactly on the frame in the **CALIB** tab.

It is no longer sufficient to just click between e.g. RED and GREEN.

You will then prompted for a password. The password is: mellon

This tab is now more clearly structured, but there are no other changes here.